YOUR ONESURVEY HOME REPORT

ADDRESS

19 Townend Place Symington, Kilmarnock KA1 5RY

PREPARED FOR

Client of Black Hay

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Black Hay

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
Single Survey	Final	D M Hall - Ayr	08/12/2020
Mortgage Certificate	Final	D M Hall - Ayr	08/12/2020
Property Questionnaire	Final	Client of Black Hay	08/12/2020
EPC	Final	D M Hall - Ayr	08/12/2020

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is essential that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

PART 1

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	YR201346
Customer	Client of Black Hay
Selling address	19 Townend Place Symington, Kilmarnock KA1 5RY
Date of Inspection	07/12/2020
Prepared by	Mark Rutherford, MA (hons) MRICS D M Hall - Ayr

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

 \square

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller:
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to
 provide financial assistance to the Purchaser towards the purchase of the
 Property and in whose favour a standard security will be granted over the
 Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property:
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3</u>: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2</u>: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities:
- ➤ *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

- · · ·	-
Description	The subjects comprise a semi detached two storey villa.
Accommodation	GROUND FLOOR: Entrance Hallway, Lounge, Kitchen, Cloakroom.
	FIRST FLOOR: Landing, Two Bedrooms, Bathroom.
Gross internal floor area (m2)	57 sq.m.
Neighbourhood and location	The property is situated within a modern residential development where surrounding properties are of a similar age and type. Local amenities are readily available.
Age	Approximately 15 years.
Weather	Overcast and dry following a recent period of settled weather conditions.
Chimney stacks	Visually inspected with the aid of binoculars where required.
	Brick construction with a render finish. The adjacent flashings are formed in lead.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where required. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally

	defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is pitched and overlaid with tiles.
	I was able to partially inspect the roof space and gained access from a hatch within the first floor landing. The roof is built of timber trusses and boarded over with timber sarking. Insulation material is laid between and over the ceiling joists.
Rainwater fittings	Visually inspected with the aid of binoculars where required.
	Rainwater units are of PVC material consisting of half round gutters discharging into round downpipes.
Main walls	Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.
	The outer walls are of brick/blockwork cavity construction having a render and pointed synthetic stonework finish. A damp proof course is not visible, however, I would anticipate a building of this to have PVC damp proof membrane.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.
	Windows are of timber double glazed design and the external doors are of UPVC double glazed design. There are timber fascia and soffit boards.
External decorations	Visually inspected.
	External decoration has a painted finish.
Conservatories /	Visually inspected.
porches	None.
Communal areas	Circulation areas visually inspected.
	None.
Garages and	Visually inspected.
permanent outbuildings	None.

Outside areas and	Visually inspected.
boundaries	There are garden grounds to the front and rear of the property, these being laid out in grass, concrete paving and timber decking. Boundary divisions are marked by timber fencing and hedging. There is a driveway to the side of the property. Visually inspected from floor level.
	Ceilings are of plasterboard material. There is a PVC lined ceiling to the bathroom.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are of timber stud construction finished in plasterboard, some having tiled wall finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. Flooring is of suspended timber construction consisting of what I assume to be chipboard laid over timber joists.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Internal joinery is of timber and there are timber internal doors, the lounge pass door incorporating glazed panels. The kitchen contains floor and wall mounted storage units.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. None.
Internal decorations	Visually inspected.

	Internal decorative finishes are generally papered or painted.
Cellars	Visually inspected where there was safe and purpose-built access.
	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
	Mains supply. The electrical consumer unit is located within the lounge.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
	Mains supply. The gas meter is located in an external meter box.
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.
	Mains water supply. Visible sections of pipework are of copper and PVC materials. Sanitary fittings in the cloakroom comprise a white suite with low level wc and wash hand basin. The bathroom comprises white suite consisting of low level wc, wash hand basin and bath. There is a stainless steel sink unit within the kitchen.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
	There is a "Valliant" wall mounted gas heating boiler situated within the kitchen. This serves water filled steel panelled radiators throughout the house and it also provides domestic

	hot water.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.
	Drainage is to the main sewerage system.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances.
	There are smoke alarms within the hallway and first floor landing.
Any additional limits to inspection	Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.
	I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.
	The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.
	Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.
	The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring. I was unable to inspect the sub floor area as there was no suitable access hatch.
	Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.
	My physical inspection of the roof void area was restricted due to insulation material and a large quantity of stored items within. As a result the roof void area was only viewed from the access hatch.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category:	
Notes:	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney stacks	
Repair category:	
Notes:	No significant defects evident.

Roofing including roof space	
Repair category:	1
Notes:	Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.

Rainwater fittings	3
Repair category:	
Notes:	No significant defects evident.

Main walls	
Repair category:	
Notes:	No significant defects evident.

Windows, external doors and joinery	
Repair category:	2
Notes:	The window unit are of an older design and wear and tear is noted. Repair/replacement in the short to medium term should be anticipated. The seals to older double glazed units often fail resulting in condensation between the panes of glass. This can occur without warning and may only be seen in certain weather conditions.

External decorati	ons
Repair category:	
	No significant defects evident.

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

repairs or replacen	nent are needed now.
Notes:	
Conservatories /	porches
Repair category:	
Notes:	None.
Communal areas	
Repair category:	
Notes:	None
Garages and per	manent outbuildings
Repair category:	
Notes:	None.
Outside areas and boundaries	
Repair category:	1
Notes:	No significant defects evident.
	1

Ceilings

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	1
Notes:	No significant defects evident.

Internal walls	
Repair category:	
Notes:	No significant defects evident.

Floors including	sub-floors
Repair category:	
Notes:	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category:	
Notes:	Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.

Chimney breasts and fireplaces		
Repair category:		
	None.	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

repairs or replacem	nent are needed now.
Notes:	
Internal decoration	ons
Repair category:	
Notes:	No significant defects evident.
Cellars	
Repair category:	
Notes:	None.
Electricity	
Repair category:	
Notes:	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.

Gas	
Repair category:	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.
it is assumed that gus appliances semply with relevant regulations.

Water, plumbing and bathroom fittings	
Repair category:	
Notes:	Seals around the bath and shower areas are frequently troublesome and require regular maintenance. Failure to seals can result in dampness and decay to adjoining/underlying areas.

Heating and hot water		
Repair category:		
Notes:	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations	
	The radiators are of an older style. A Gas Safe registered contractor can advise further.	

Drainage	
Repair category:	
Notes:	No significant defects evident.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

<u>Unrestricted parking within 25 metres:</u> For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	[x]YES []NO
3. Is there a lift to the main entrance door of the property?	[]YES [x]NO
4. Are all door openings greater than 750mm?	[]YES [x]NO
5. Is there a toilet on the same level as the living room and kitchen?	[x]YES []NO
6. Is there a toilet on the same level as a bedroom?	[x]YES []NO
7. Are all rooms on the same level with no internal steps or stairs?	[]YES [x]NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES []NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

No obvious significant issues based upon the limitations of my inspection.

Estimated re-instatement cost (£) for insurance purposes

115,000

(ONE HUNDRED AND FIFTEEN THOUSAND POUNDS). It should be noted this sum is an estimate calculated by using a rate per square metre

Valuation (£) and market comments

£130,000

(ONE HUNDRED AND THIRTY THOUSAND POUNDS).

Demand in line with prevailing market conditions is anticipated.

Report author:	Mark Rutherford, MA (hons) MRICS		
Company name:	D M Hall - Ayr		
Address:	15 Miller Road Ayr KA7 2AX		
Signed:	Electronically Signed: 172530-BD44622C-40C8		
Date of report:	08/12/2020		

P A R T 2.

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	19 Townend Place Client: Client of Black Hay Symington, Kilmarnock						
	KA1 5RY	Tenure: Absol	Tenure: Absolute Ownership				
Date of Inspection:	07/12/2020	Reference: YR201346					
This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.							
1.0	LOCATION	LOCATION					
	r is situated within a modern resi amenities are readily available.	dential developr	nent where sur	rounding properties are of a si	milar age and		
2.0	DESCRIPTION		2.1 Age:	Approximately 15 years.			
The subjects comprise a semi detached two storey villa.							
3.0	CONSTRUCTION						
The external walls are of cavity brick/blockwork construction. The roof is pitched and tiled.							
4.0	ACCOMMODATION						
GROUND FL	_OOR: Entrance Hallway, Loung	je, Kitchen, Cloa	akroom.				

SERVICES (No tests have been applied to any of the services)

Mains

Gas fired boiler to radiators

Electricity:

None

Gas:

Mains

Drainage:

OUTBUILDINGS

Mains

5.0

6.0

Garage:

Water:

Central Heating:

Mains

Others:		None.				
7.0	of any woodw The report can defects, partic Where defects accurate estin purchase. Ge	GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.				
	e subjects were t fects which woul			ring regard to age and style of in evidence.	construction. No	o obvious
8.0	ESSENTIAL I	REPAIR WORK	(as a condition	of any mortgage or, to preser	ve the condition	of the
None.						
8.1 Retention	n recommended	d:	N/A			
9.0	ROADS &FO	OTPATHS				
Made up.						
10.0	BUILDINGS I	NSURANCE	115,000	GROSS EXTERNAL FLOOR AREA	69	Square metres
	This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.					
	allowance has	been included been made for	for inflation dur	ing the insurance period or dur	ring re-construc	tion and no
11.0	allowance has	s been included s been made for vised.	for inflation dur	ing the insurance period or dur	ring re-construc	tion and no
	allowance has allowance has insurers is adv	s been included s been made for vised. EMARKS	for inflation dur VAT, other tha	ing the insurance period or dur	ring re-construct r discussions wi	tion and no th your
	allowance has allowance has insurers is add GENERAL RI ted, the property VALUATION adverse plant necessary Locinvestigation of matters to be asbestos in or beyond the so	s been included been made for vised. EMARKS Was occupied, On the assumpting proposals, cal Authority confront and contamination outwith the scope of this inspector of this inspector.	for inflation during VAT, other that the furnished and furnished furnished and furnish	ing the insurance period or dur n on professional fees. Further	ring re-construction discussions will be a constructed or area was not been sought and made as we contify without a tests should be acceptanced.	tion and no th your of inspected. by any the umed that all the consider such contain est. It is lyised that if
When inspec	allowance has allowance has insurers is add GENERAL RI ted, the property VALUATION adverse plant necessary Locinvestigation of matters to be asbestos in or beyond the so	s been included a been made for vised. EMARKS was occupied, On the assumpting proposals, cal Authority coof any contamination outwith the scope of this inspector concerns then in present	for inflation during VAT, other that the furnished and furnished furnished and furnish	n on professional fees. Further n on professional fees. Further loors were covered. The sub floors were covered. The sub floors were covered, the properties, title restrictions or servitude or within the property has been and the property has been to fittings. It is impossible to idea or asbestos and future occupants.	ring re-construct r discussions wi oor area was no ty is unaffected rights. It is asso been sought and n made as we do year 2000 may o ntify without a te ats should be ad appropriate test	tion and no th your ot inspected. by any umed that all d obtained. No consider such contain est. It is lvised that if s.
When inspec	allowance has allowance has allowance has insurers is add. GENERAL RI ted, the property VALUATION adverse plant necessary Locinvestigation of matters to be asbestos in or beyond the so they have any Market Value	s been included a been made for vised. EMARKS Was occupied, On the assumpting proposals, cal Authority contaming outwith the scope of this inspector of the concerns then in present:	for inflation during VAT, other that the value of the vacant properties components of they should as they shoul	n on professional fees. Further n on professional fees. Further loors were covered. The sub flates, title restrictions or servitude or within the property has been required, have to any have been required, have to rewithin the property has been any fittings. It is impossible to idear asbestos and future occupants for a specialist to undertake and for a specialist to undertake and for the	ring re-construct r discussions wi oor area was no ty is unaffected rights. It is asso been sought and n made as we do year 2000 may o ntify without a te ats should be ad appropriate test	tion and no th your ot inspected. by any umed that all d obtained. No consider such contain est. It is lvised that if s.
When inspec	allowance has allowance has allowance has insurers is add. GENERAL RI ted, the property VALUATION adverse plant necessary Lowers in our investigation of matters to be asbestos in our beyond the softhey have any market Value condition (£) Market Value completion of the softhey have any market Value completion of t	s been included a been made for vised. EMARKS was occupied, On the assumpting proposals, cal Authority coof any contamin outwith the scope of this inspector concerns then in present: e on of essential	for inflation during VAT, other that the value of the vacant properties components of they should as they shoul	n on professional fees. Further n on professional fees. Further loors were covered. The sub flates, title restrictions or servitude or within the property has been required, have to any have been required, have to rewithin the property has been any fittings. It is impossible to idear asbestos and future occupants for a specialist to undertake and for a specialist to undertake and for the	ring re-construct r discussions wi oor area was no ty is unaffected rights. It is asso been sought and n made as we do year 2000 may o ntify without a te ats should be ad appropriate test	tion and no th your ot inspected. by any umed that all d obtained. No consider such contain est. It is lvised that if s.
12.0 12.1 12.2	allowance has allowance has allowance has insurers is add. GENERAL RI ted, the property VALUATION adverse plant necessary Locinvestigation of matters to be asbestos in order they have any Market Value condition (£) Market Value completion of works (£): Suitable second market second market value completion of works (£):	s been included a been made for vised. EMARKS Was occupied, On the assumpting proposals, cal Authority contaming outwith the scope of this inspector of the cope of this inspector of the concerns then the in present: e on of essential	for inflation during VAT, other that the value of the vacant properties components of they should as 130,000	n on professional fees. Further n on professional fees. Further loors were covered. The sub flates, title restrictions or servitude or within the property has been required, have to any have been required, have to rewithin the property has been any fittings. It is impossible to idear asbestos and future occupants for a specialist to undertake and for a specialist to undertake and for the	ring re-construct r discussions wi oor area was no ty is unaffected rights. It is asso been sought and n made as we do year 2000 may o ntify without a te ats should be ad appropriate test	tion and no th your ot inspected. by any umed that all d obtained. No consider such contain est. It is lvised that if s.
12.0 12.1 12.2 12.3	allowance has allowance has insurers is add GENERAL RI ted, the property VALUATION adverse plant necessary Lowestigation of investigation of matters to be asbestos in order have any Market Value condition (£) Market Value completion of works (£): Suitable secunormal morting purposes?	s been included a been made for vised. EMARKS was occupied, On the assumpth ing proposals, cal Authority conformer of its cope of this inspector concerns then in present: e on of essential urity for gage	for inflation duric VAT, other that the value of this reports components of they should as 130,000 - Yes 07/12/2020	n on professional fees. Further n on professional fees. Further loors were covered. The sub flates, title restrictions or servitude or within the property has been required, have to any have been required, have to rewithin the property has been any fittings. It is impossible to idear asbestos and future occupants for a specialist to undertake and for a specialist to undertake and for the	ring re-construct r discussions wi oor area was no ty is unaffected rights. It is asso been sought and n made as we do year 2000 may o ntify without a te ats should be ad appropriate test	tion and no th your ot inspected. by any umed that all d obtained. No consider such contain est. It is lvised that if s.

D M Hall	- Ayr	
Office:	15 Miller Road Ayr KA7 2AX	Tel: 01292 286974 Fax: email: ayr@dmhall.co.uk,margaret.gray@dmhall.co.uk

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	19 Townend Place Symington, Kilmarnock KA1 5RY
Customer	Client of Black Hay
Customer address	19 Townend Place Symington, Kilmarnock KA1 5RY
Prepared by	Mark Rutherford, MA (hons) MRICS D M Hall - Ayr

Energy Performance Certificate (EPC)

Dwellings

Scotland

19 TOWNEND PLACE, SYMINGTON, KILMARNOCK, KA1 5RY

Dwelling type: Semi-detached house
Date of assessment: 07 December 2020
Date of certificate: 07 December 2020

Total floor area: 57 m²

Primary Energy Indicator: 183 kWh/m²/year

Reference number: 0636-1909-6202-2500-0204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£1,410	See your recommendations
Over 3 years you could save*	£81	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

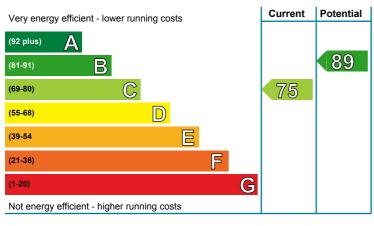


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (75)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

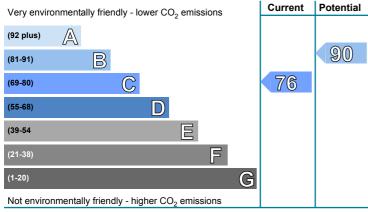

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (76)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Solar water heating	£4,000 - £6,000	£81.00
2 Solar photovoltaic (PV) panels	£3,500 - £5,500	£960.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity	****	★★★★☆
Roof	Pitched, 250 mm loft insulation	****	★★★★☆
Floor	Suspended, insulated (assumed)	_	_
Windows	Fully double glazed	****	★★★★ ☆
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	★★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 32 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£999 over 3 years	£999 over 3 years	
Hot water	£252 over 3 years	£171 over 3 years	You could
Lighting	£159 over 3 years	£159 over 3 years	save £81
Totals	£1,410	£1,329	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December and management	Indicative cost	Typical saving	Rating after improvement	
Recommended measures	Indicative cost	per year	Energy	Environment
1 Solar water heating	£4,000 - £6,000	£27	C 76	C 78
2 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£320	B 89	B 90

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,840	N/A	N/A	N/A
Water heating (kWh per year)	1,816			-

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Mark Rutherford

Assessor membership number: EES/009464

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 15 Miller Road

Ayr KA7 2AX

Phone number: 01292 286974

Email address: enquiries@dmhall.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



PART 4.

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



PROPERTY QUESTIONNAIRE

PROPERTY ADDRESS:

19 Townend Place Symington


KA1 5RY

SELLER(S):

Jonathan Burns & Amy Burns

COMPLETION DATE OF PROPERTY QUESTIONNAIRE:

07/12/2020

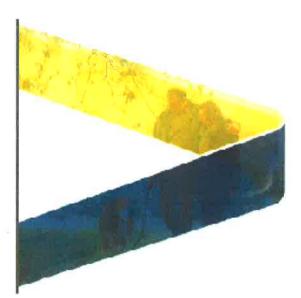









PROPERTY QUESTIONNAIRE

NOTE FOR SELLERS

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.

PROPERTY QUESTIONNAIRE Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 9 Years
2.	Council Tax
	Which Council Tax band is your property in? Band D
3.	Parking



	What are the arrangements for parking at your property? (Please indicate all that apply) • Driveway	
4.	Conservation Area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed Buildings	, W.
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations / additions / extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe the changes which you have made:	No



	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes/No
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	No
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes/No
	(ii) Did this work involve any changes to the window or door openings?	Yes/No



(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent. 7. **Central heating** Yes Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes/partial - what kind of central heating is there? **GAS-FIRED** (Examples: gas-fired, solid fuel, electric storage heating, gas warm air.) If you have answered yes, please answer the 3 questions below: b. When was your central heating system or partial central heating system installed? When the house was built, but new boiler fitted 2 years ago



c.	Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance agreement:	No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes/No



b.	Are you aware of the existence of asbestos in your property?						
	If you have answered yes, please give details:						
10.	Services						
a.	Please tick which servic	os aro connectos	I to your property and				
a.	give details of the suppl		i to your property and				
	Services	Connected	Cupplior				
	Services	Connected	Supplier				
	Gas / liquid petroleum GAS Green Energy gas						
	Water mains / private water supply						
	Electricity Electricity Green Energy						
	Mains drainage Telephone Telephone BT						
	Cable TV / satellite						



	Broadband	Broadband	ВТ	
b.	Is there a septic tank sys	,	•	No
C.	Do you have appropriat septic tank?	e consents for t	he discharge from your	Yes/No/ Don't Know
d.	Do you have a maintena If you have answered y with which you have a m	<u>res</u> , please give	details of the company	Yes/No
11.	Responsibilities for Sha	red or Common A	Areas	

a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	No
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	No



C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	No
	If you have answered yes, please give details:	
е.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	No
f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	No
12.	Charges associated with your property	



a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges: Ross & Lindell manage the factor of the grounds - contribute to the upkeep of estate (gardening, communal park etc) approximately £20 per month	Yes
b.	Is there a common buildings insurance policy?	Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Don't know
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.	
13.	Specialist Works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property	No



b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details					
C.	If you have answered y guarantees relating to the purchaser and shown possible for checking. please write below who solicitor or estate agen You will also need to prout. This may be show Guarantees are held by	this work? es, these guld be giver If you do not has these t will arrang rovide a des	uarante of to you of have docum je for ti scriptio	ees will be ir solicitor them you ents and y hem to be on	needed by as soon as rself our obtained.	Yes/No
14.	Guarantees					
a.	Are there any guarante following:	es or warra	nties fo	or any of th	е	
(i)	Electrical work	No	Yes	Don't Know	With titl deeds	e Lost
(ii)	Roofing	No	Yes	Don't Know	With titl deeds	e Lost
(iii)	Central heating	No	Yes	Don't know	With titl deeds	e Los
(iv)	NHBC	No	Yes	Don't know	With titl deeds	e Los
(v)	Damp course	No	Yes	Don't know	With titl deeds	e Los



(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost
b.	b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
C.	Are there any outstanding classed above? If you have answered yes, plants				uarantees	No
15.	Boundaries					
	So far as you are aware, ha been moved in the last 10 ye	ars?			ur property	No
16.	Notices that affect your prop	erty				
	In the past 3 years have you	ever r	eceive	d a notice:		
a.	advising that the owner of a a planning application?	neighl	bouring	g property	has made	Yes
b.	that affects your property in	some	other v	way?		No



C.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.	

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief. Signature(s):
Amy Burns
Date: 07/12/20